

Mount Thorley Warkworth Monthly Meaningful Summary

Environment Protection Licence 1376

Environment Protection Licence 1976

Environment Protection Licence 24

May 2017

Date Published: 23rd June 2017

EPA public register: http://www.epa.nsw.gov.au/publicregister/

EPL	Licensee	Premises
1376	Warkworth Mining Ltd PO Box 315 Singleton NSW 2330 Australia	Warkworth Coal Mine Putty Road, Mount Thorley NSW 2330 Australia
24	Mount Thorley Coal Loading Ltd PO Box 315 Singleton NSW 2330 Australia	Mount Thorley Coal Loading Ltd Mount Thorley Road, Mount Thorley VIA Singleton NSW 2330 Australia
1976	Mount Thorley Operations Pty Limited PO BOX 315 Singleton NSW 2330	Mount Thorley Operations Mount Thorley Road, Mount Thorley NSW 2330 Australia

Contents

1.0 INTRODUCTION	1
2.0 AIR QUALITY	2
2.1 Particulate Matter <10μm (PM10) Monitoring	2
2.1.1 PM10 Results	2
3.0 SURFACE WATER	4
3.1 Mine Water Discharge Monitoring	4
3.2 Hunter River Tributaries Monitoring	4
4.0 BLAST MONITORING	5
Appendix A: Mount Thorley Warkworth Monitoring Location Plans	7

Figures

Figure 1 Mount Thorley Warkworth Environmental Monitoring Locations	8
Tables	
Table 1: Particulate Matter <10µm Monitoring	2
Table 2: Mine Water Discharge Monitoring	4
Table 3: Hunter River Tributaries Monitoring	5
Table 4: Blast Monitoring	

1.0 INTRODUCTION

This report has been compiled to provide a summary of environmental monitoring results for Mount Thorley Warkworth in accordance with Environment Protection Licences 1376, 1976 and 24. This report includes all monitoring data collected in accordance with the aforementioned licences for the period 1st May – 31st May 2017.

The Environmental Protection Licence 1376 may be found here:

http://www.epa.nsw.gov.au/prpoeoapp/ViewPOEOLicence.aspx?DOCID=85647&SYSUID=1&LICID=1376

The Environmental Protection Licence 1976 may be found here:

http://www.epa.nsw.gov.au/prpoeoapp/ViewPOEOLicence.aspx?DOCID=85860&SYSUID=1&LICID=1976

The Environmental Protection Licence 24 may be found here:

http://www.epa.nsw.gov.au/prpoeoapp/ViewPOEOLicence.aspx?DOCID=32017&SYSUID=1&LICID=24

Monitoring in this report includes:

- Air quality monitoring;
- Surface water monitoring including mine water discharge; and
- Blast monitoring.

2.0 AIR QUALITY

To monitor regional air quality, MTW operates and maintains a network of 5 Particulate Matter $<10\mu m$ (PM10) Monitors (DustTrak II) on mine owned land surrounding the mining operations. The location of these monitors can be found in Appendix A - MTW Monitoring Location Plan.

2.1 Particulate Matter <10µm (PM10) Monitoring

2.1.1 PM10 Results

Results of Particulates (PM_{10}) monitoring (EPA Monitoring Points 9, 10, 11, 12 and 13) are shown in Table 3. Results reported represent the 24hr average PM_{10} , derived from 10 minute PM_{10} values for the period midnight to midnight, for each calendar date during the reporting period. The last sampling date was 31st May 2017; the data was obtained on the 1st June 2017.

- EPA Identification Number 9 (WML 1376) Warkworth North
- EPA Identification Number 10 (WML 1376 & MTO 1976) **Dragline Crossing**
- EPA Identification Number 11 (WML 1376 & MTO 1976) Heavy Vehicle Bridge
- EPA Identification Number 12 (WML 1376 & MTO 1976) MTIE
- EPA Identification Number 13 (MTO 1976) MTO Boundary

Results of Particulates (PM10) monitoring (EPA Monitoring Points 9, 10, 11, 12 and 13) are shown in Table 1.

Table 1: Particulate Matter <10μm Monitoring

	Unit of	Monitoring Frequency	Monitoring Point						
Date	Measure	Continuous	Warkworth North	MTO Boundary	Dragline Crossing	Heavy Vehicle Bridge	MTIE		
1/05/2017	μg/m³		#	16.9	23.1	32.0	7.4		
2/05/2017	μg/m³	-	#	17.3	26.9	31.0	9.5		
3/05/2017	μg/m³	-	#	13.5	40.5	16.2	4.1		
4/05/2017	μg/m³	-	16.7	9.4	21.0	10.4	#		
5/05/2017	μg/m³		14.2	7.3	21.9	17.7	#		
6/05/2017	μg/m³		10.0	18.1	29.8	32.0	#		

7/05/2017	$\mu g/m^3$		17.3	23.2	26.7	30.3	#
8/05/2017	μg/m³		29.1	14.9	44.3	18.8	5.8
9/05/2017	μg/m³]	22.9	12.4	33.7	16.0	4.4
10/05/2017	μg/m³]	14.5	12.9	33.8	24.0	6.1
11/05/2017	μg/m³]	24.0	33.9	37.2	#	17.1
12/05/2017	μg/m³]	99.4	149.7	53.2	#	108.2
13/05/2017	μg/m³]	56.4	45.8	31.1	64.9	36.2
14/05/2017	μg/m³]	#	#	#	#	#
15/05/2017	μg/m³]	#	#	#	#	#
16/05/2017	μg/m³]	#	#	#	#	#
17/05/2017	μg/m³]	24.2	17.5	31.1	30.1	14.7
18/05/2017	μg/m³]	32.5	#	27.6	#	#
19/05/2017	μg/m³		12.7	7.9	7.2	8.3	3.8
20/05/2017	μg/m³		8.5	10.8	6.0	15.5	4.8
21/05/2017	μg/m³		14.2	15.4	11.2	26.0	10.2
22/05/2017	μg/m³]	23.1	16.9	23.7	17.3	10.2
23/05/2017	μg/m³		25.1	32.6	16.2	43.7	17.2
24/05/2017	μg/m³		7.4	20.4	8.7	26.4	11.7
25/05/2017	μg/m³		6.0	12.5	12.7	23.7	8.4
26/05/2017	μg/m³]	13.0	12.6	22.0	20.7	8.0
27/05/2017	μg/m³]	20.2	21.0	33.8	29.3	14.8
28/05/2017	μg/m³]	18.1	24.3	16.3	36.4	13.3
29/05/2017	μg/m³]	#	7.5	6.2	13.4	4.4
30/05/2017	μg/m³	1	#	14.6	8.8	21.5	4.7
31/05/2017	μg/m³	1	7.4	11.3	24.4	19.4	5.0

[#] Data unavailable due to equipment or communications issue

3.0 SURFACE WATER

3.1 Mine Water Discharge Monitoring

MTW participates in the Hunter River Salinity Trading Scheme (HRSTS), and maintains two monitoring locations associated with this scheme as follows:

- EPA Monitoring Point 1 (WML EPL 1376) **Dam 1N Discharge Point**
- EPA Monitoring Point 4 (MTO EPL 1976) The end of the discharge pipe from Dam 9

Mount Thorley Warkworth did not receive any discharge opportunities in the reporting period and no water was discharged. As such, no samples were collected at Monitoring Points 1 and 4 during the reporting period (shown in Table 2 below).

Table 2: Mine Water Discharge Monitoring

	Pollutant	Unit of measure	Licence Limits	No. of samples required by licence	No. of samples you collected and analysed	Lowest sample value	Mean of sample	Highest sample value	Median
Dam 1N Discharge /	Conductivity	microsiemens per centimetre		0	0	-	-	-	-
Dam 1N Discharge / EPL Point 1	pН	рН	6.5 - 9.0	0	0	-	-	-	-
	Total Suspended Solids	milligrams per litre	120	0	0	-	-	-	-
Dam OS Dischargo /	Conductivity	microsiemens per centimetre		0	0	-	-	-	-
Dam 9S Discharge / EPL Point 4	рН	рН	6.5 - 9.0	0	0	-	-	-	-
	Total Suspended Solids	milligrams per litre	120	0	0	-	-	-	-

3.2 Hunter River Tributaries Monitoring

MTW undertakes routine monitoring in Loders Creek, in accordance with Condition M2.3, at the following location:

• EPA Monitoring Point 3 (MTO EPL 1976) – In Loders Creek, at the coal preparation plant access road bridge

The location of these sampling points can be found in Appendix A – MTW Monitoring Locations Plan.

Result of monitoring undertaken from W5 – Loders Creek is detailed in Table 3. Monthly sampling occurred on 11th May 2017, the data was obtained on 8th June 2017.

Table 3: Hunter River Tributaries Monitoring

	Pollutant	unit of measure	No. of samples required by licence	No. of samples you collected and analysed	Lowest sample value	Mean of sample	Highest sample value	Median
	Conductivity	microsiemens per centimetre	1	1	10850	10850	10850	10850
Loders Creek / EPL Point 3	pН	pН	1	1	7.7	7.7	7.7	7.7
	Total Suspended Solids	milligrams per litre	1	1	8	8	8	8

4.0 BLAST MONITORING

In accordance with the requirements of Conditions M7.1 (WML 1376) and M8.1 (MTO 1976), Mount Thorley Warkworth maintains a network of blast monitors to measure airblast overpressure and ground vibration for all blasts carried out at MTW. The following monitoring locations (EPA Monitoring Points 4/5, 5/6, 6/7, 7/8 and 8/9) are listed on the licences for the purpose of assessing compliance with the airblast overpressure and ground vibration criteria:

- EPA Identification Number 4 (WML 1376) and Number 5 (MTO 1976) respectively Warkworth
- EPA Identification Number 5 (WML 1376) and Number 6 (MTO 1976) respectively Wambo Road
- EPA Identification Number 6 (WML 1376) and Number 7 (MTO 1976) respectively **Bulga Village**
- EPA Identification Number 7 (WML 1376) and Number 8 (MTO 1976) respectively Wollemi Peak Road; and
- EPA Identification Number 8 (WML 1376) and Number 9 (MTO 1976) respectively **Putty Road MTIE**

The location of these monitors can be found in Appendix A – Mount Thorley Warkworth Environmental Monitoring Locations.

The last date sampled was on 31^{st} May 2017. The data was obtained on the 9^{th} June.

Blast monitoring results are detailed in Table 4.

Compliance Summary:
During the reporting period no blasts exceeded the 115 dB(L) threshold for airblast overpressure or the 5mm/s threshold for ground vibration.
Detailed blast results may be viewed in Obtained Data Report for May 2017.

Table 4: Blast Monitoring

	Pollutant	Unit of Measure	No. of samples required by licence	No. of samples collected and analysed	lowest sample value	mean of sample	highest sample value	Median
Bulga Village		dB(L)	30	30	82.94	93.69	104.16	92.90
Wambo Road		dB(L)	30	30	74.27	93.71	107.23	93.70
Putty Rd MTIE		dB(L)	30	30	79.80	97.45	112.23	96.64
Warkworth		dB(L)	30	30	82.79	91.62	103.59	91.84
Wollemi Peak Road		dB(L)	30	30	86.16	96.24	107.86	97.31
Bulga Village		mm/s	30	30	0.03	0.94	2.47	0.75
Wambo Road		mm/s	30	30	0.03	0.65	1.76	0.70
Putty Rd MTIE		mm/s	30	30	0.03	0.16	0.38	0.14
Warkworth		mm/s	30	30	0.05	0.54	2.27	0.45
Wollemi Peak Road		mm/s	30	30	0.03	0.87	2.85	0.66

A A. Managa Theorie	XX/I	Anning a Langue
Appendix A: Mount Thorley	y warkworth Moni	toring Location Plans

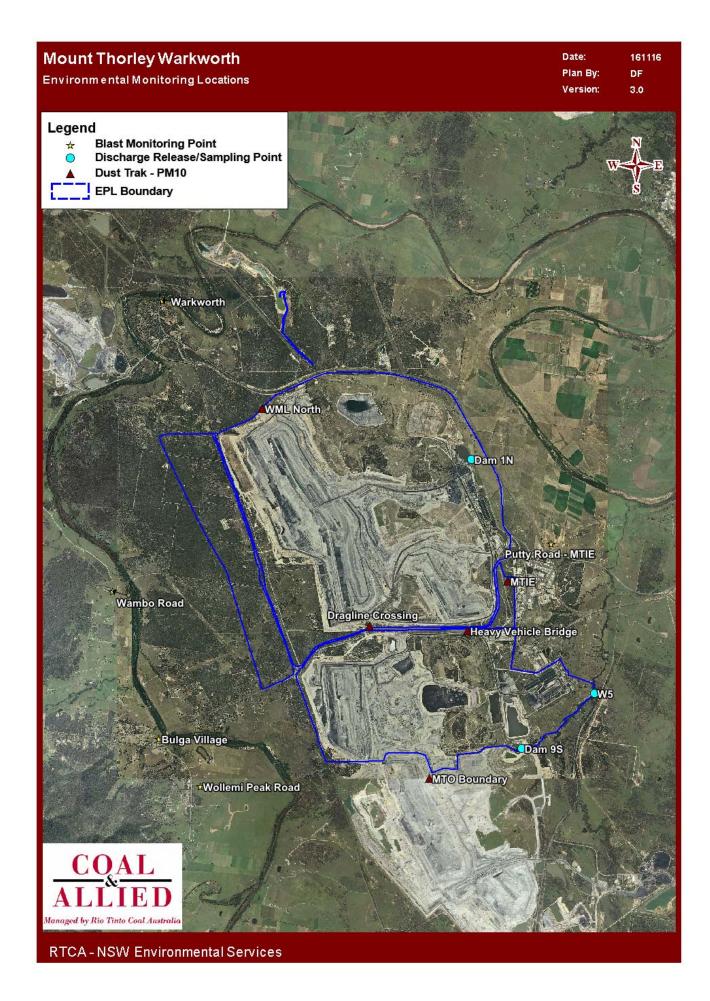


Figure 1: Mount Thorley Warkworth Environmental Monitoring Locations